



Delco Carburetor

BULLETIN: 9D-3T


DATE: JUNE 1980

PAGE 1 of 5

FILE AFTER BULLETIN 9D-3S

TROUBLE — SHOOTING THE MODEL 2 GC — 2 GV CARBURETOR

ALWAYS CHECK FIRST:
Heat Riser, Intake Manifold Bolts,
Compression, Ignition System,
Fuel Pump Pressure and Volume,
Crankcase Vent System, Vacuum
Hoses, and Emission
Control Systems for
Proper Operation.

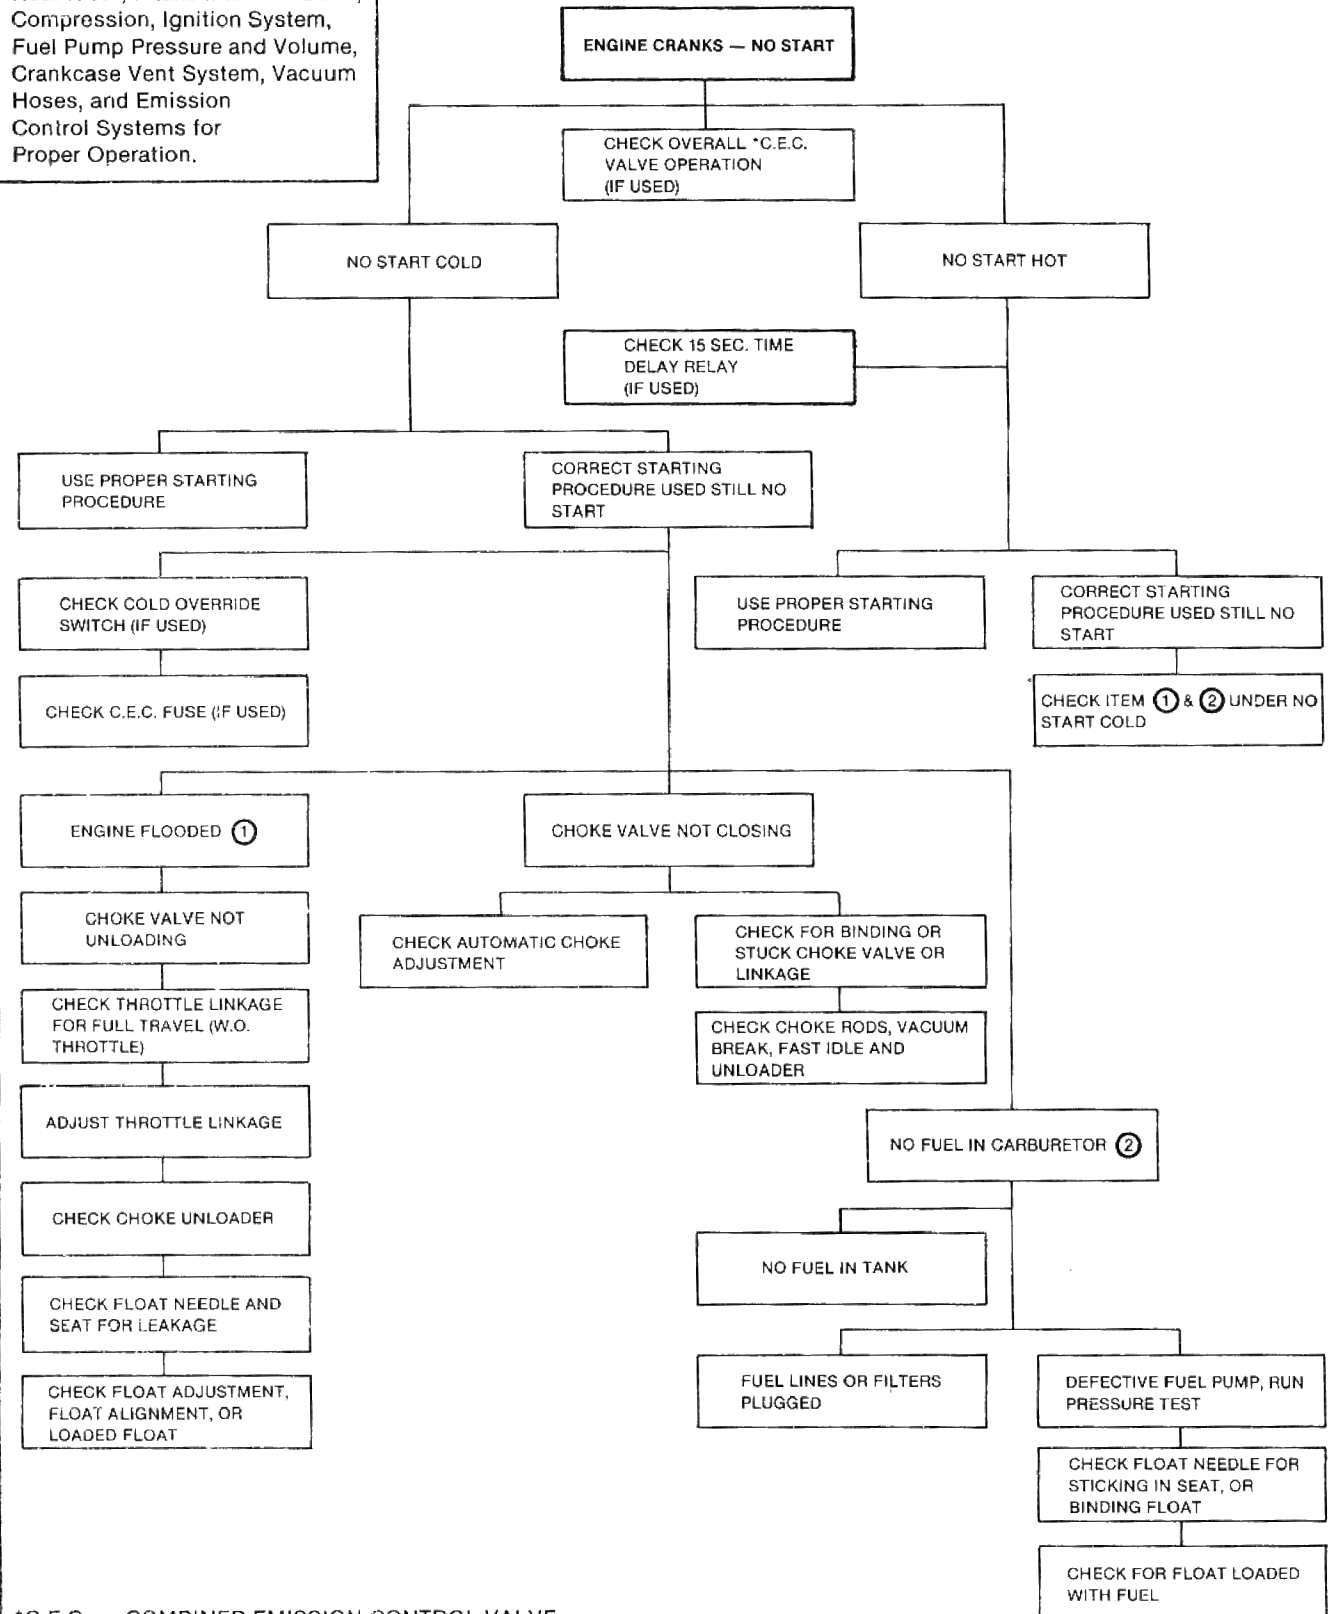


*C.E.C. — COMBINED EMISSION CONTROL VALVE

Delco Carburetor



TROUBLE — SHOOTING THE MODEL 2 GC — 2 GV CARBURETOR CONT'D.

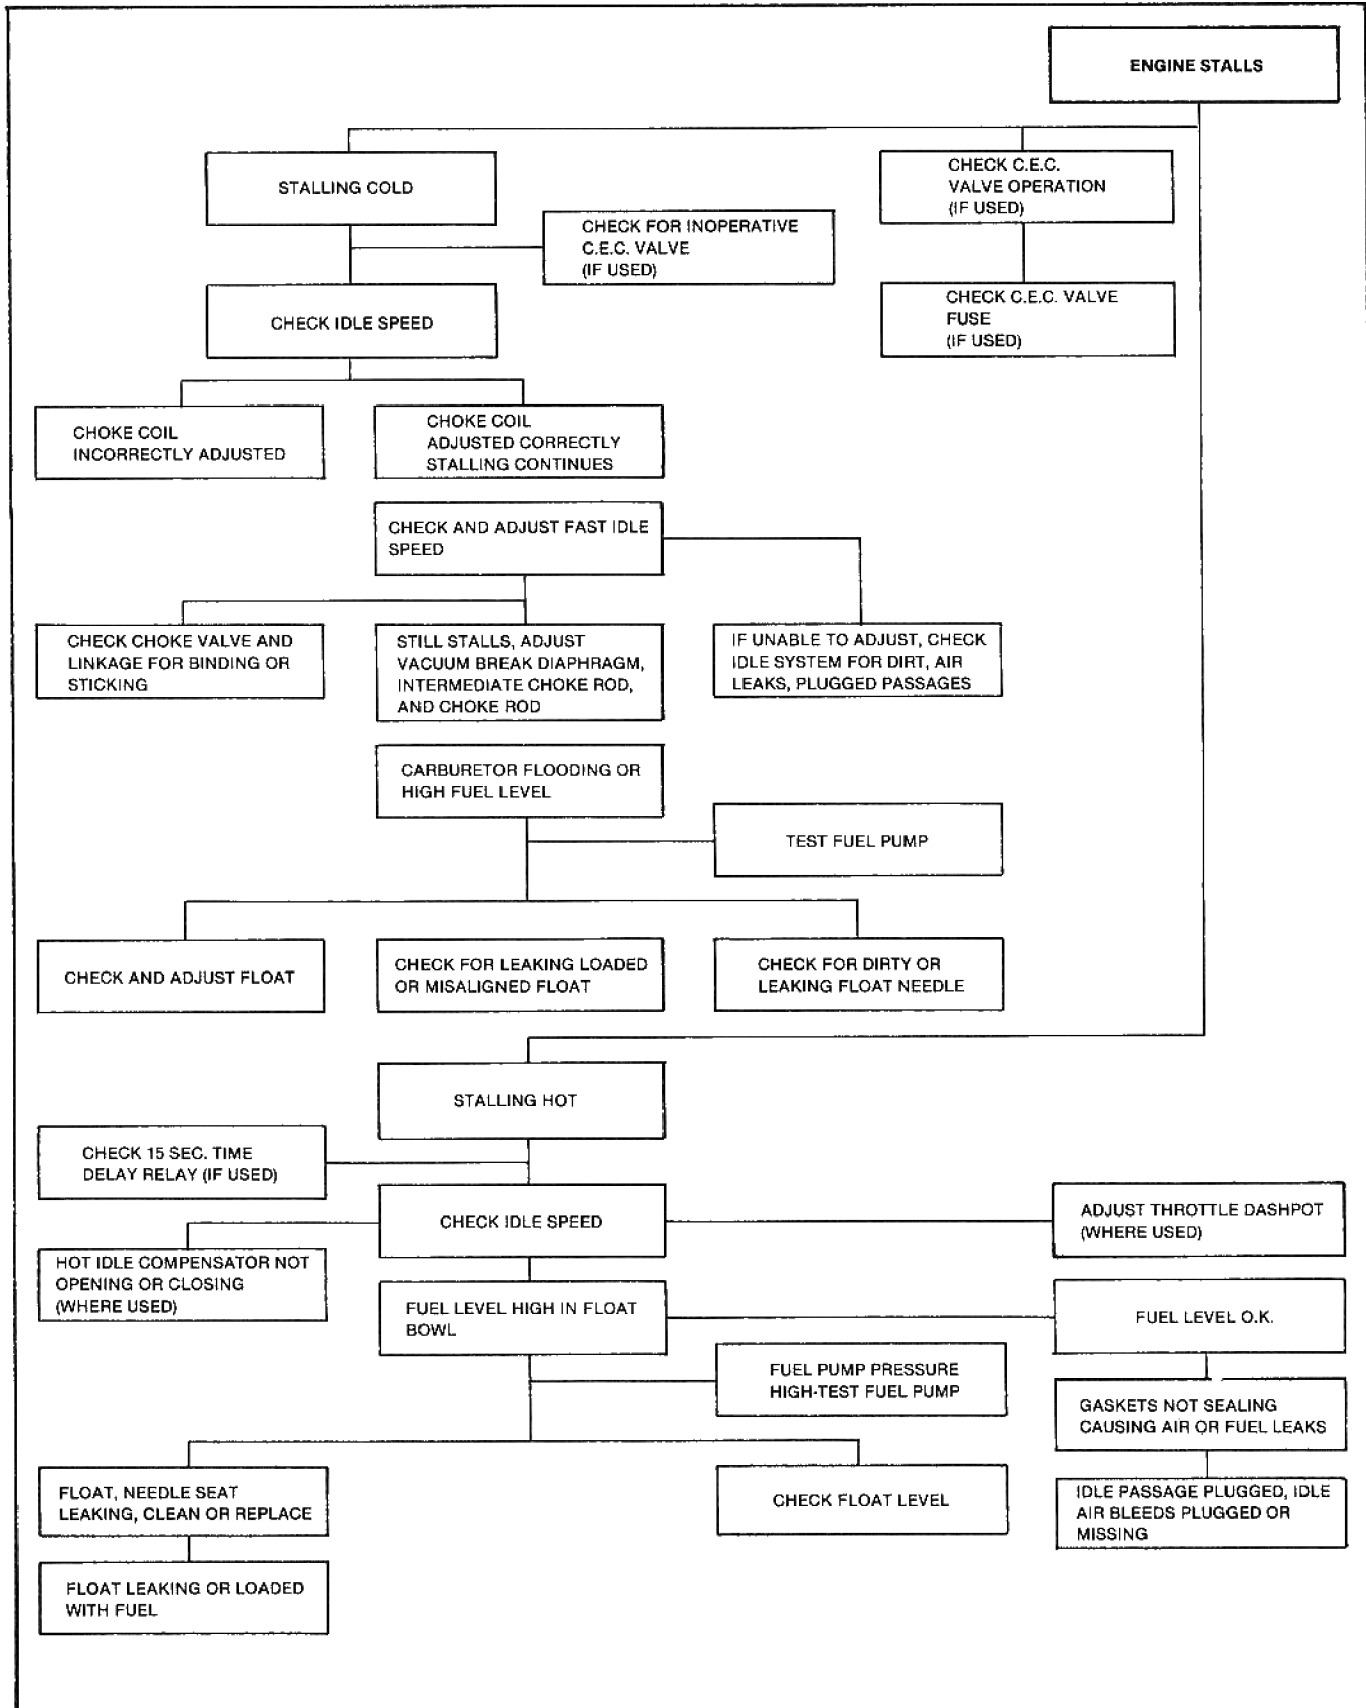



Delco Carburetor


BULLETIN 9D-3T

DATE: JUNE 1980

PAGE 3 of 5

FILE AFTER BULLETIN 9D-3S


TROUBLE — SHOOTING THE MODEL 2 GC — 2 GV CARBURETOR CONT'D.

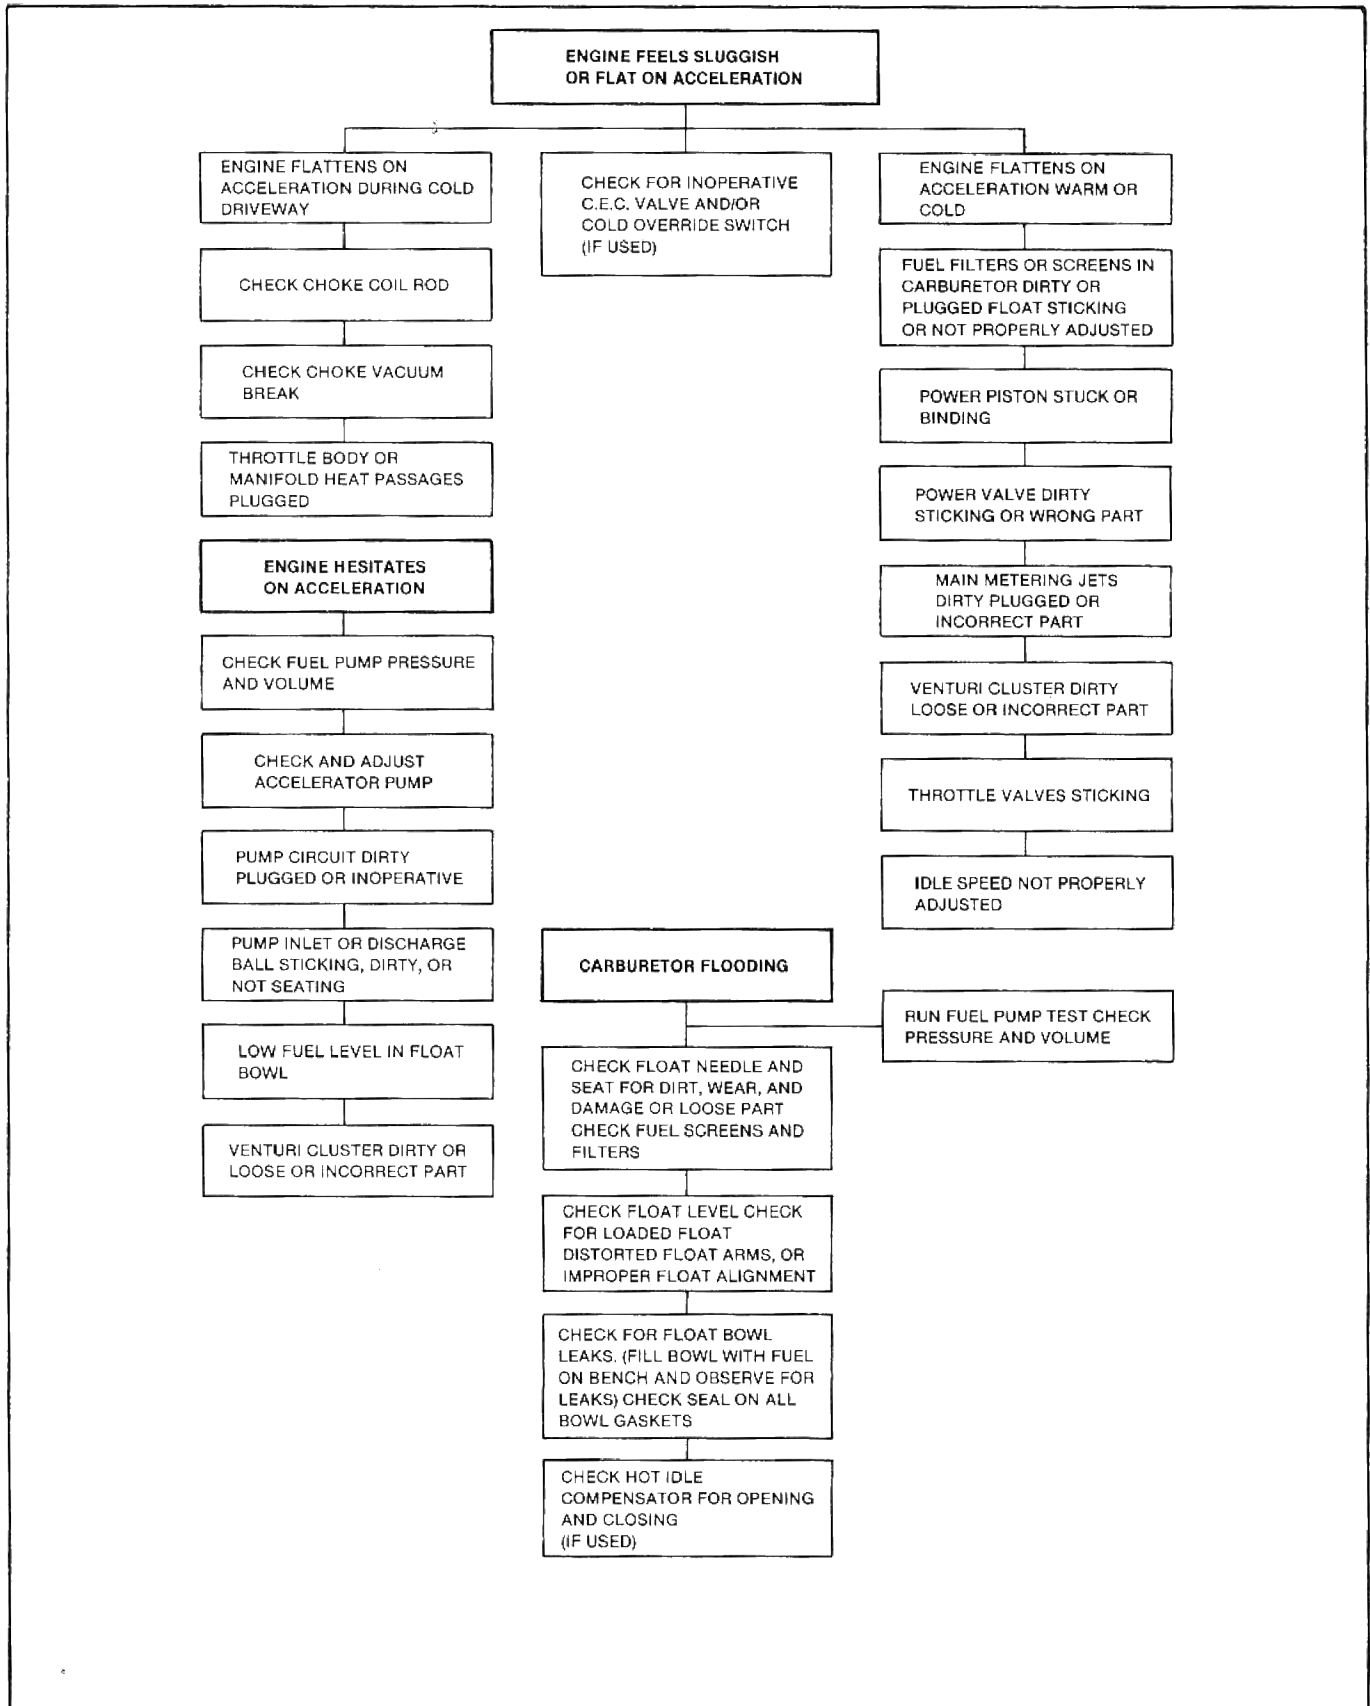

Delco Carburetor



TROUBLE — SHOOTING THE MODEL 2 GC — 2GV CARBURETOR CONT'D

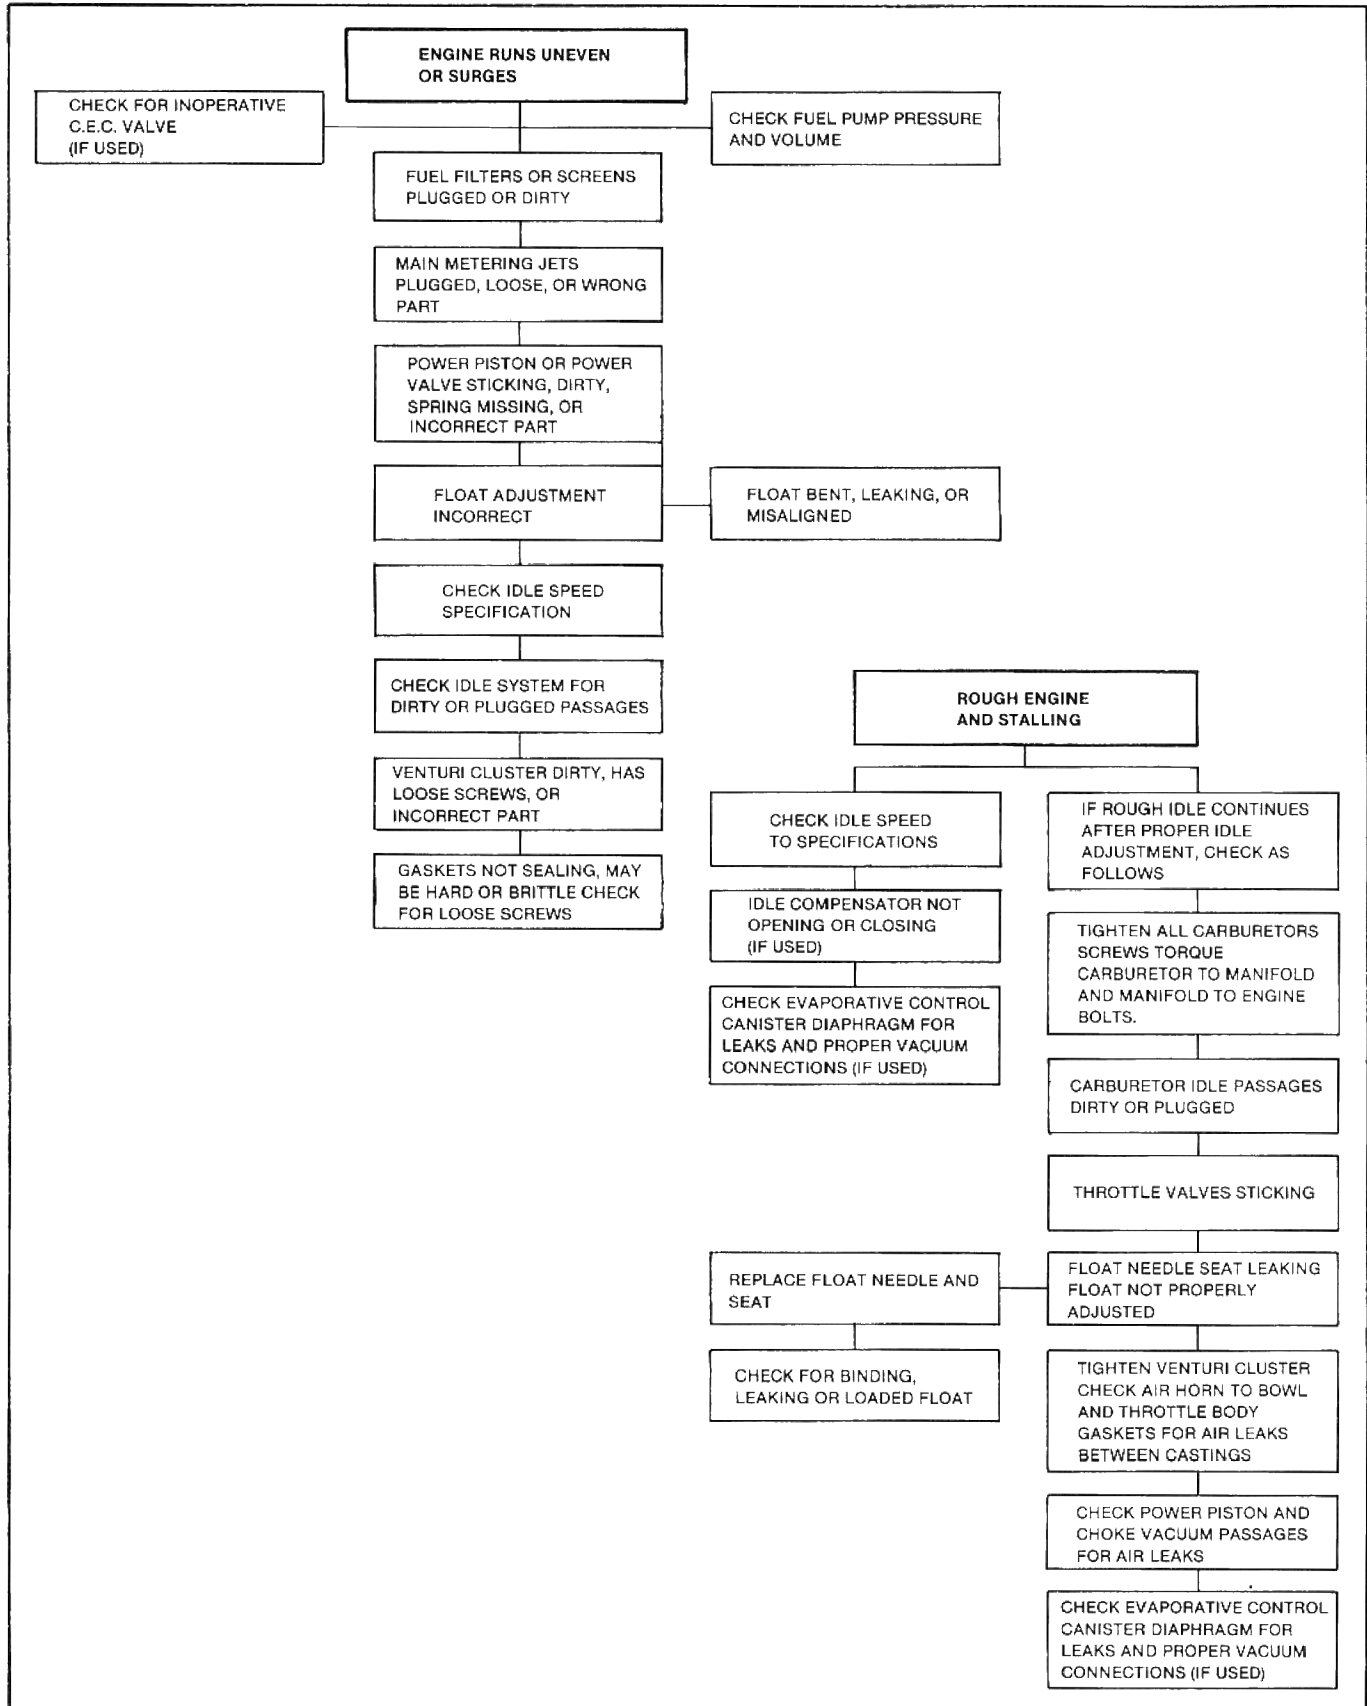



Delco Carburetor

BULLETIN 9D-3T

DATE: JUNE 1980

PAGE 5 of 5

FILE AFTER BULLETIN 9D-3S

TROUBLE — SHOOTING THE

MODEL 2 GC — 2 GV CARBURETOR CONT'D.

